

(MANUAL)

Welford Lever Antique Brass Manual Valve Set (Angled Manual)

		Valve to Radiati Valve to Pipe To adjust Lock-Sl
		To fit Coupler to Ra Alle
		Max Test Pressu
		Max Operating Pre
		Max Differential Pre
Available	e Finishes	Pressure Drop Value
Antique Brass	Satin Nickel	Kvs value is the metr valve. It is defined as: of water at a tempera pressure of
		Normal Flow Ra Max Flow Rate
	<u> </u>	– Te

Connection size				
Valve to Radiators	1/2" BSPT			
Valve to Pipe	15 mm Compression			

Allen Key size				
To adjust Lock-Shield	N/A			
To fit Coupler to Radiator	12 mm			
Allen Keys are not included				

Pressure Ratings			
Max Test Pressure	12 Bar		
Max Operating Pressure	10 Bar		
Max Differential Pressure	1 Bar		
Pressure Drop Value (Kvs)	1.6 m ³ /h		
Kvs value is the metric measure for the flow of a fully opened			
valve. It is defined as: The volume flow in cubic metres per hour			
of water at a temperature of between 5° and 40° Celsius with a			
pressure drop across the valve of 1 bar.			

Flow Ratings			
Normal Flow Rate	0.23 m ³ /h		
Max Flow Rate	0.32 m ³ /h		

Temperature Ratings		
Max Test Temperature	120°C	
Max Operating Temperature	110°C	
Temperature Adjustment Range	N/A	

Disclaimer


All dimensions are approximate and for roughing in only.

We recommend no work be carried out until the goods arrive.

We can take no responsibility for errors in information supplied.



Welford Lever Antique Brass Manual Valve Set (Angled Manual)

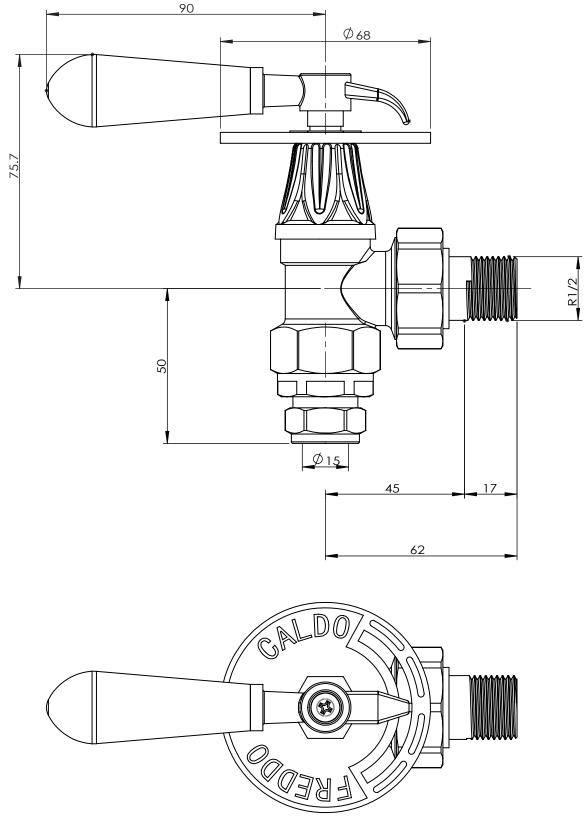



Manual Valve Installation

Your radiator valves should only be installed by a competent and suitably qualified installer. Your warranty may be void if installation is not carried out by a suitably qualified heating engineer.

All plumbing joints should be sealed using appropriate tools, methods and materials. Never over tighten any joint or coupling.

Ensure care is taken to protect the decorative finish on the valves during installation. We would recommend applying protection (for example, at least two layers of paper between the faces of the nuts and any spanner) to ensure the surfaces are not marked.